

## Release Notes for Dominion® PX Software Version 1.2.7 (firmware version will be displayed as 01.02.07 in the GUI after an upgrade)

Version: DPX 1.2.7 Release Notes, Revision 1.3

Date: January 7, 2009

**Effective:** Immediately.

### Applicability:

**This firmware release is for ALL PX models EXCEPT the following models:**

**DPXR4X1A-16NP, DPXS20A-16AU-M, and DPX8A-16AU-M.**

**Please do NOT upgrade these models to PX 1.2.7, as it will result in a unit becoming non-functional.**

For customers using CC-SG 4.0, note restrictions below in Known Issues with Release 1.2.7 section below.

**IMPORTANT - Upgrade Matrix: - The following upgrade paths MUST be followed, otherwise it can result in a unit that needs to be returned to the factory.**

- Single Phase Models running firmware versions 1.0.n:
  - 1.00.nn MUST UPGRADE TO 1.01.nn BEFORE UPGRADING TO 1.02.nn FROM 1.01.nn (where n is a number)
- Single Phase Models running firmware versions 1.01.05/1.01.06:
  - 1.1.5-6724/1.1.6-6889 MUST upgrade to 1.02.0-7173 BEFORE UPGRADING TO 1.2.7-7272
- All Other Models (from-> to)
  - 1.2.1 ->1.2.7-7367
  - 1.2.2 -> 1.2.7-7367

The upgrade path for customers with these units - **DPXR4X1A-16NP, DPXS20A-16AU-M, and DPX8A-16AU-M** - will be a future release.

Release 1.2.7 CANNOT and MUST not be downgraded to ANY prior PX release.

**Release Status:** General Availability (GA)

### Dominion PX Overview:

Dominion PX refers to Raritan's family of intelligent power distribution units.

**Release 1.2.7 contains all enhancements and fixes in PX 1.2.5 which are listed below:**

- A) Auto-refresh on home page, every 30 seconds
- B) Added a new field "PDU Power Cycling Delay" of Device Settings > Unit Setup page to allow the unit to delay power on for until 3600 seconds (range 0-3600 seconds, default value (zero) 0 = no delay on unit power up) have elapsed after power restoral. NO outlets on the PDU would come on until this delay timer has expired. This allows for UPS batteries to charge up to an acceptable level, or for power to be stable, before the PDU allows power to flow to the outlets. [14682]
- C) Microsoft Active Directory Authentication with SSL enabled not working [7171]. The root cause was incorrect setting of the date for the PX unit. Once the date is set correctly, security certificates work correctly with the Dominion PX.
- D) User Guide has a new and improved Alerts chapter.
- E) Line and Circuit Breaker status on the home page.
- F) The graphical user interface (GUI) now shows the Raritan serial number for the environmental sensor; in prior releases, it showed a different identifier. The sensor unit itself shows a Raritan serial number, so it is easy to troubleshoot.
- G) Configuration Copy and Save for Bulk Configuration (See section immediately below for details).
- H) Support for new international 3-phase models.
- I) Dominion PX slowdown coinciding with connectivity lost message in event log (16550).
- J) Indexing in SNMP starts from 1 and not 0. Allows easier integration with some SNMP MIB browsers and SNMP managers. (16895)
- K) PDU-based sample collection retrievable via SNMP.




## Copying Configurations with Bulk Configuration

The Bulk Configuration feature lets you save the settings of a configured Dominion PX unit to your PC. This file can be used to copy that configuration to other PX units of the same model type. Users saving Dominion PX configurations require the Bulk Configuration system permission. Users copying configurations require both the Bulk Configuration and the Unit Reset permissions.



A dialog box with a blue header titled "Save Configuration". Below the header, there are two buttons: "Save Configuration" and "Cancel".

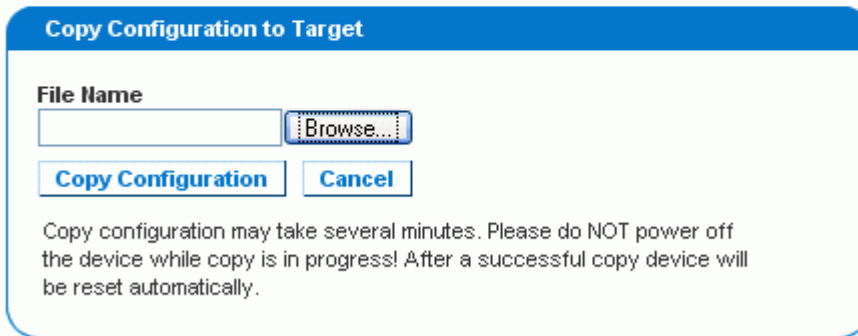

A dialog box with a blue header titled "Copy Configuration to Target". Below the header, there is a "File Name" label followed by a text input field and a "Browse..." button. Below these are two buttons: "Copy Configuration" and "Cancel". At the bottom of the dialog, there is a warning message: "Copy configuration may take several minutes. Please do NOT power off the device while copy is in progress! After a successful copy device will be reset automatically."

---

*Note: The Bulk configuration feature is available for the following model- **DPXR4X1A-16NP**- in release 1.2.6.*

---



For Raritan PX Customers Only

---

## Saving a Dominion PX Configuration

A saved Dominion PX configuration file contains the settings that can be shared between Dominion PX units, such as user and group configurations, thresholds, alert policies, the access control list, etc. This file does not contain device-specific information, including:

- Device Name
- System Name, System Contact and System Location
- Network settings (IP address, Gateway and Netmask)
- Local Time
- Outlet Names and Outlet Status
- External Sensor Names and Sensor Mappings
- Device Logs
- Outlet Grouping Data
- Default Outlet State (at either the Unit level or Outlet level)

The Default Outlet State setting is not saved. This prevents accidentally leaving outlets OFF after the configuration has been copied. Also, while the Local Time is not copied, any NTP settings are saved.

► **To save a configuration file:**

1. Choose Maintenance > Bulk Configuration. The Bulk Configuration window opens.
2. Click **Save Configuration**. Your web browser will prompt you to save a file. Choose a suitable location and save the configuration file to your PC.



---

### Copying a Dominion PX Configuration

Copying a Dominion PX configuration to a unit will adjust that Dominion PX's settings to match those of the source unit. In order to successfully restore a Dominion PX configuration:

- The user must have the Bulk Configuration and Unit Reset system permission.
- The target Dominion PX must be the same model type as the source Dominion PX.
- The target Dominion PX must be running the same firmware version as the source Dominion PX.

▶ **To copy a Dominion PX Configuration:**

1. Login to the target unit's web interface.
2. If the firmware version does not match that of the source Dominion PX, choose Maintenance > Update Firmware to update the firmware of the target Dominion PX.
3. Choose Maintenance > Bulk Configuration. The Bulk Configuration window opens.
4. Under the *Copy Configuration to Target* area, click **Browse** and select the configuration file on your PC.
5. Click **Copy Configuration**.



For Raritan PX Customers Only

Consult the Dominion PX User Guide for more information on these PX features.

### **Dominion PX Documentation:**

The following user documentation is available for the Dominion PX:

The latest English language User Guide for PX1.2.5 (PDF format) documentation should be used with this release; it is available from Raritan's website via a hyperlink from the GUI.

### **Not Supported with the Dominion PX 1.2.7:**

KSX G1 does not support the Dominion PX.

PX models **DPXR4X1A-16NP, DPXS20A-16AU-M, and DPX8A-16AU-M** are NOT supported by this release.

### **Upgrade Matrix (path for upgrades):**

Upgrade Matrix: See IMPORTANT note under Upgrade Matrix above BEFORE upgrading firmware on any unit.

### **Dominion PX Release 1.2.7 Compatibility Information:**

1. KSX (G1) units do not support the DPX.
2. Upgrade Matrix: See IMPORTANT note under Upgrade Matrix above BEFORE upgrading firmware on any unit.

### **Important Notes and Information:**

- A) Enable Javascript in your browser before logging into the unit to start the upgrade process.
- B) When the firmware upgrade is complete, check the firmware version on the Home page in the left panel – it should show “Firmware 01.02.07” after the upgrade. This is the displayed designation for the Dominion PX firmware release 1.2.7.
- C) Before any environmental sensors are into a unit with an Ethernet cable attached to it, a ferrite core (Raritan part number DPX-FERCORE) must be installed within 1.5-3 inches (3.8-7.6 cm) of the RJ45 jack on the end of the Ethernet cable that plugs into the DPX unit; this part is included in each environmental shipped. Only one ferrite core is required per LAN, regardless of how many sensors are plugged into the Feature port of the Dominion PX unit. If your Dominion PX Unit does not have an Ethernet cable installed, the ferrite core is not required.



For Raritan PX Customers Only

- D) When a customer wants to restart or upgrade a PX device from Command Center Secure Gateway (CC-SG) the following steps must be followed for proper operation:
- a. Pause managing the device.
  - b. Restart/Upgrade PX.
  - c. When PX is fully booted, resume managing the device. [FCR15440, 12777, 12807]
- E) Thresholds on some North American and Japanese PX units have to be adjusted to the derated values (maximum) allowed by NEC codes. The UI will not allow the user to enter a value more than the system specified limits for critical thresholds. As part of the models table audit, the specified current on some models is being reduced (derated).

If the user has set a threshold value that is greater than the derated value being set by the 1.2.5 upgrade, after upgrading to 1.2.7, the PX will have a threshold value that exceeds the system limit.

For example for DPCR8-15, the max value for threshold will be 15. As part of firmware upgrade to PX 1.2.7, customers need to plan to change this value to 12. If the customer had set the threshold value to any value greater than 12A, prior to the upgrade, then customer would then have threshold above the system limits, and if enabled, an alert, SNMP trap, and syslog event may be generated. [17910]

- F) Circuit breaker mapping is incorrect in outlet details page for both DPXR and DPCR models.

The logic in outlet details page assumes that the first half of outlets will map to CB1 and second half on CB2; this will hold good for rackable (zero U) models. However, it will be incorrect for DPCR and DPXR models with 12 and 20 outlets. For example, DPXR units will be 1-4 CB1 and 5-12 CB2  
DPCR models will show 1-8 - CB1 and 9-12 CB2.  
Currently it shows incorrectly as 1-6 on CB1 and 7- 12 on CB2

This problem exists in releases prior to PX release 1.2; it will be fixed in PX1.3. [18141]

### **Known Issues with DPX Release 1.2.7:**

1. When adding a PX running PX1.2.7 firmware to CC-SG 4.0, the user will see a warning that this release is not supported, please ignore and override this



For Raritan PX Customers Only

message, because the PX1.2 will functions correctly with CC-SG4.0. In a future CC-SG release, this warning message will be removed.

2. When a customer wants to restart or upgrade a PX device from CC-SG the following steps must be followed for proper operation:
  - a. Pause managing the device.
  - b. Restart/Upgrade PX.
  - c. When PX is fully booted, resume managing the device. [FCR15440, 12777, 12807]
3. PX slows down when the SMTP server is not reachable. This is observed when the PX and the SMTP servers are in different subnets. This will be addressed in a future release. [16028]
4. Outlet on/off event is not captured in the event log when the event is generated with an alert with that outlet on/off as destination. [16029]
5. In the outlet alert event, the Outlet names remains as the default (e.g., Outlet 1, Outlet 4) for all outlets, even outlet names are changed. [16090]
6. When the current loading is close to, or smaller than, 0.1A, the Power Factor always shows something (e.g., 0.208), but RMS current shows “0”. This issue will be resolved in a future release.
7. When setting thresholds, the real IPMI sensor data is shown for thresholds, so it is possible that some values – 10.0A cannot be set for a threshold, a value of 9.97A may show when the threshold value is set to 10.0A. This is due to the enhanced accuracy encoding used internally in IPMI.
8. **Due to improvements in PX 1.2.7, you cannot downgrade from Release 1.2.7 to Release 1.2.0, 1.1, 1.1.6, 1.1.5, 1.0, 1.0.3, or 1.0.4 or any other release lower than 1.0.3.**
9. Minimum power-on delay displayed by IPMI is greater than one second. The GUI will display and allow values to be less than one second.
10. Unable to uncheck (disable) Eventlog assignments when more than one Eventlog targets are selected. A workaround is to Enable syslog forwarding, uncheck all checkboxes and Apply to save changes. Now you can select/deselect the checkboxes for local event logging. This behavior is not observed for SMTP or NFS logging. This is observed only with Syslog.
11. Only when single the user login restriction is Enabled (which is not the default setting), an attempt to login by a second admin user when one admin user is logged in, may result in the first admin user being logged out. Therefore, it is strongly recommended that the single user limitation not be used in this firmware release (1.2); instead, assign users to different groups with appropriate access privileges. This limitation will be removed in a subsequent release.





12. The unit of power factor is still "null". PowerFactor in IPMI is no longer percentage data type, but it says "null" not "ratio". PowerFactor should have a ratio data-type, not a percentage data type in IPMI. This issue is expected to be resolved in a future release. [ 13667]
13. When terminating the web browser GUI session, the user should logout of the unit using the Logout button, and NOT close the session by clicking on the Close window (X) button on the top right hand corner. When this is not done, then the user session will remain open and appear in the Active Sessions panel until the Inactivity Timer expires. Therefore, it is highly recommended that the inactivity timer be set to a small number of minutes, for example 5-10 minutes. [15986]
14. Outlet details are displayed blank when the current exceeds the upper non-critical thresholds. [16448]
15. Switch (on/off/cycle) traps are not generated when SNMP and Switch outlet on/off/cycle (or SNMP and Current outlet on/off/cycle) have been set as the alert destinations (16936, 16904). This will be fixed in a future release.
16. Switch (on/off/cycle) SMTP emails are not generated when SMTP and Switch outlet on/off/cycle (or SMTP and Current outlet on/off/cycle) have been set as the alert destinations. (16937, 16902). This will be fixed in a future release.
17. For the DPXR8A-16 unit displays PDU Power Rating value is wrong in web page, it shows 3700VA, it should be 3680VA. This will be fixed in a future release. [18194]
18. The PX1.2.0 firmware is missing 4 models that will impact subsequent upgrade to 1.2.5 for these models: DPXR8-20L, DPXR20A-30L6, and DPXS12-30L, and DPXS12A-20L6. [17906]

Failure Scenario:

- \* Upgrade from 1.2.0 to 1.2.5 or 1.2.7
- \* PSOC upgrade will fail.
- \* Controller FW upgrade will succeed.
- \* User informed that Relay Board upgrade failed.
- \* Eric is stopped.

Recovery Steps:

- \* Reset PX by Power Cycle OR the RESET BUTTON.
- \* Upgrade from 1.2.5/1.2.7 to 1.2.5/1.2.7.
- \* User is informed that upgrade is successful.

**Release Package Details:**



For Raritan PX Customers Only

The Release 1.2.7 package for the Dominion PX series has the following components. Note that the binary file is posted as a Zip file under firmware upgrades on Raritan's website, and must be unzipped before it can be installed on the Dominion PX unit:

“DominionPXReleaseNotes1\_2\_7v1\_3” – this file  
A firmware release (binary):  
**fw-kira-rpc-pdu-raritan\_010207-7367.bin**

### **Firmware Upgrade Pre-requisites:**

If you have any questions, or cannot follow the instructions below, please STOP and contact Raritan Technical Support for further instructions. Please read the entire instructions (this document) before proceeding.

### **General Upgrade Instructions** (standalone upgrade from the browser based user interface):

1. Ensure no users are logged in; nor are there any active sessions – besides the current admin session.
2. The user upgrading the PX device must be a member of the default Admin Group to have sufficient administrator-level privileges to update the Dominion PX unit.
3. Five to ten minutes are required for the complete update procedure. The update and subsequent reboot time will vary according to the number of outlets in the unit.
4. Upgrade the Dominion PX unit using a wired network only. Loss of packets/dropouts over a wireless network may result in a failed upgrade.
5. If doing the firmware upgrade over a VPN, ensure that the connection is stable and that no inactivity timeouts have been set.
6. The detailed, step-by-step instructions to perform the upgrade are given below.
7. The software upgrades are written to flash memory, and this takes time to complete. Please do not power-off the unit, or disconnect the Ethernet connection, while the upgrade is going on.
8. **Enable Javascript in your browser.**



For Raritan PX Customers Only

9. Save the firmware upgrade file on a local or network accessible directory. Unzip the file and save it in an accessible directory.

10. Should you experience any difficulties with the upgrade, call Raritan Technical Support for assistance.

### Step-by-Step Upgrade Instructions:

1. Please ensure that no users are logged into the unit. Note that the upgrade will not interrupt power to the outlets; nor will it change the state of the outlet – outlets that are on will remain on; similarly, outlets that are off will remain off – both during the firmware upgrade and following the (software) reset to load the new firmware into the unit.
2. In Mozilla Firefox, Internet Explorer (or other supported web browser), type in the IP address of your Dominion PX unit, and wait for the web-based interface to load.
3. Logon as an administrative user “admin” (or other member of the Admin Group).
4. Click on the “Unit Reset” command under the “Maintenance” tab. This will clear certain internal debug log files to ensure a smooth upgrade. The delay between a Unit Reset, and a firmware upgrade, should be kept to less than 10 minutes.
5. When asked to confirm with a “Reset Device” prompt, click on the “Reset” button. Another prompt to “Really reset” will be presented, click on the “Reset” button. Once the device resets – this will take about one (1) minute – and you will be logged out and taken to the Login page. Login again, with your admin username and password. Note that the Reset will NOT change any outlet states – outlets will maintain their previous state; outlets that are ON will remain ON, and outlets that are OFF, will remain OFF.
6. Click on the “Update Firmware” command under the “Maintenance” tab.
7. Browse to locate the **.bin** file containing the update: **fw-kira-rpc-pdu-raritan\_010207-nnnn.bin** (Note: this has to be an UNzipped file).

The full path name might look as in the example below (the file path on your system may differ):

“C:\Documents and Settings\user\My Documents\My Downloads\fw-kira-rpc-pdu-raritan\_010207-nnnn.bin” (where nnnn is a 4-digit number).



For Raritan PX Customers Only

Click the “Upload” button.

The current firmware, and future (after the upgrade) firmware versions, will be displayed. Click the “Upgrade” button to start the upgrade.

8. The firmware upgrade will then proceed:
  - a. Other users cannot operate the PX during the upgrade; however, power is NOT interrupted to any outlets.
  - b. This upgrade step will take 4-10 minutes, depending on how many outlets are in the unit.

**DO NOT REBOOT OR POWER CYCLE THE PX DURING THE UPGRADE OR THE REBOOT!**

- c. When the upgrade is completed, the admin user will be logged off.

9. The Dominion PX unit will now reboot and reset, which may take up 1-2 minutes.

10. The user will be taken back to the Login page when the upgrade is completed. IF, and only if, you are not seeing the login page after more than 12 minutes, close ALL web browser sessions, and log back in after the reset completes. (Hint: You may have Javascript disabled; please enable it).

11. When the firmware upgrade is complete, check the firmware version on the Home page in the left panel – it should show “Firmware 01.02.07” after the upgrade.

12. Due to improvements in PX 1.2.7, you cannot downgrade from Release 1.2.7 to Release 1.0.

13. If you have any questions or issues during the update, call Raritan Technical Support for assistance.

Copyright ©2008-2009 Raritan, Inc. CommandCenter, Dominion, and the Raritan company logo are trademarks or registered trademarks of Raritan, Inc. All rights reserved. Solaris and Java are trademarks of Sun Microsystems, Inc. Windows and Windows Vista are trademarks or registered trademarks of Microsoft Corporation. Mac and Safari are trademarks or registered trademarks of Apple, Inc. All other marks are the property of their respective owners.



For Raritan PX Customers Only