

Dominion SX R3.1.6 Technical Bulletin

Release Date: December 4, 2008

Description

Dominion SX units that cannot obtain an IP address through DHCP or configured with static IP addresses may not perform configuration backup successfully.

Resolution


Issue the following command from the local terminal port, SSH or Telnet: 'admin > Config > Log > eventlogfile style wrap'. This command needs to be executed only once and all subsequent backup operations will be successful.

Description

The new Raritan Serial Console (RSC) version 3.0, part of the 3.1.6 release may not open successfully if the 'History Buffer Size' setting in Emulator/ Settings menu of RSC was set to a value higher than 8192 before the upgrade.

Resolution


Set the 'History Buffer Size' setting in Emulator/ Settings menu to be less than 8192 before the upgrade.

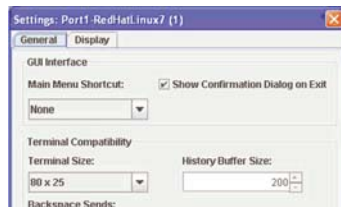

In case you have already upgraded the unit that had a higher value and you are facing difficulty opening the RSC, the following procedure resolves it:

regedit :

HKEY_CURRENT_USER\Software\JavaSoft\Prefs\com\raritan\serial console\sx\ui

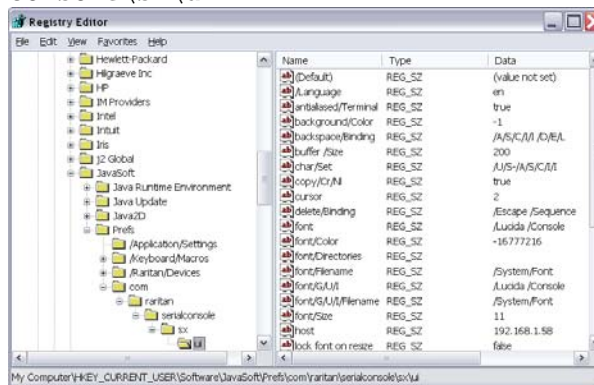

Delete all settings there and try opening RSC again.

Raritan Inc.
400 Cottontail Lane
Somerset, NJ 08873
USA
Tel. 1-732-764-8886
Fax. 1-732-764-8887
E-mail: sales@raritan.com
<http://www.raritan.com>

Raritan Europe
Eglantierbaan 16
2908 LV Capelle aan den IJssel
The Netherlands
Tel. (31) 10-284-4040
Fax (31) 10-284-4049
E-mail: sales.europe@raritan.com
<http://Raritan.info>

Raritan Japan
4th Floor, Shinkawa NS Building
1-26-2 Shinkawa, Chuo-Ku
Tokyo 104-0033, Japan
Tel. (81) 03-3523-5991
Fax (81) 03-3523-5992
E-mail: sales.japan@raritan.com
<http://Raritan.co.jp>

Raritan Taiwan
5F, 121, Lane 235, Pao-Chiao Road
Hsin Tien City
Taipei Hsien, Taiwan, ROC
Tel. (886) 2 8919-1333
Fax (886) 2 8919-1338
E-mail: sales.ap@raritan.com
<http://Raritan.com.tw>